

Manhole Inspection Summary

Manhole # S01O__029MH

Printed On: 6/24/2010

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **01O** Node: **029** Status: **Found**

Insp Date: **5/22/08 11:17 AM**

Incomplete Comments

Crew: **RL, WJ, RG**
Inspector: **Lamont**
Firm: **URS**

Location Address: **301 BEECHFIELD AVE**

Cross Street: **STAFFORD ST**

Manhole Type: **Inline** Location: **Easement / Right of Way**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **32** (in.) Length: (in.) Dist A/B Grade: **36** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Precast Concrete** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Precast Concrete** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


Steps Count: **8** Missing: **0** ☐ Corroded

Surcharge ☒ **Evidence Of Surcharge** Depth: **10** (ft.) ☐ Active Surcharge Present


Location View



Top View

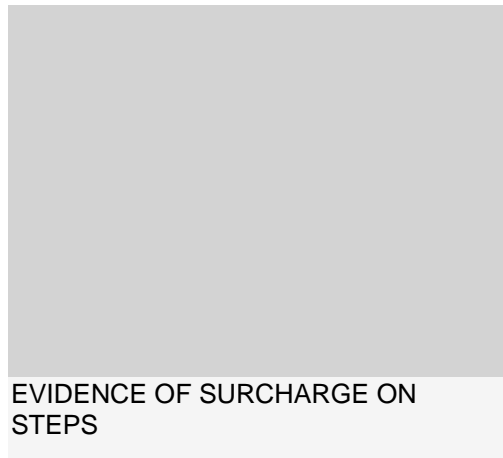

Defect 1

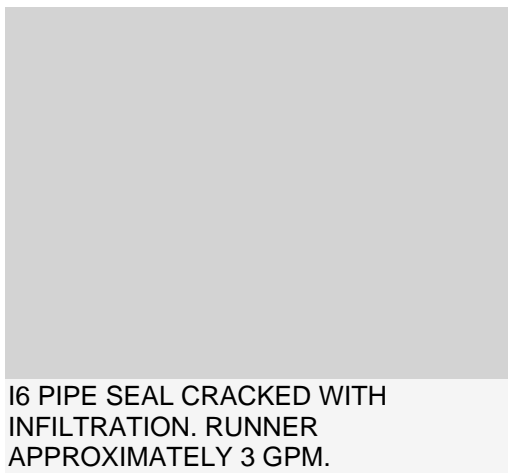

I6 PIPE SEAL CRACKED WITH
INFILTRATION. RUNNER
APPROXIMATELY 3 GPM.

Manhole Inspection Summary

Manhole # S01O__029MH

Printed On: 6/24/2010

Page 3 of 3

18 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **18** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.30** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

18 in. Circular Gravity Sewer
Pipe In @ 7 O'Clock

7 O'Clock Inflow



CRACKED PIPE SEAL WITH INFILTRATION
(RUNNER)

Pipe Height: **18** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.90** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Runner** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection